


TransTechnical Bulletin

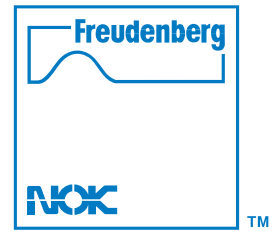

Application: Ford 5/R55N, Jaguar S 1999-Up, Lincoln LS 2000-Up

Subject: Oil Pan Gasket Revision

The pan gasket for this unit is made of the same design as the AX4S/N with a plastic core and molded rubber sealing surfaces. A revision has been made to the plastic core: a tab was added to prevent the roll pin that retains the manual lever from falling out.

This was a running change in the first several months of production and all current production units have been fitted with the updated pan gasket. TransTec #32800 is the current Ford part in inventory for kit production and bulk sales.

Failure to use the molded pan gasket with the tab may result in loss of vehicle control or gear selection. Please refer to the illustration for positive identification of the early and late gaskets.

