


Transtech ***Bulletin***

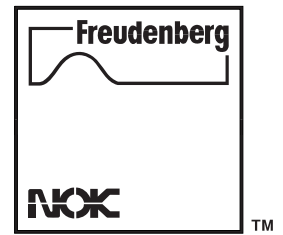

Application: General Motors

Subject: 4T80E 1993-Up Valve Body Gasket

General Motors has altered the hydraulics of the 4T80E slightly for all models from 1993-up. The hatchet passage for line pressure has been modified by removing the handle. With this change, the gasket now matches the separator plate and does not allow line pressure to be orificed into the reverse clutch passage. See the accompanying illustration.

This is a running change by General Motors and will work on all units. The revised gasket has a white ink stripe for additional identification.

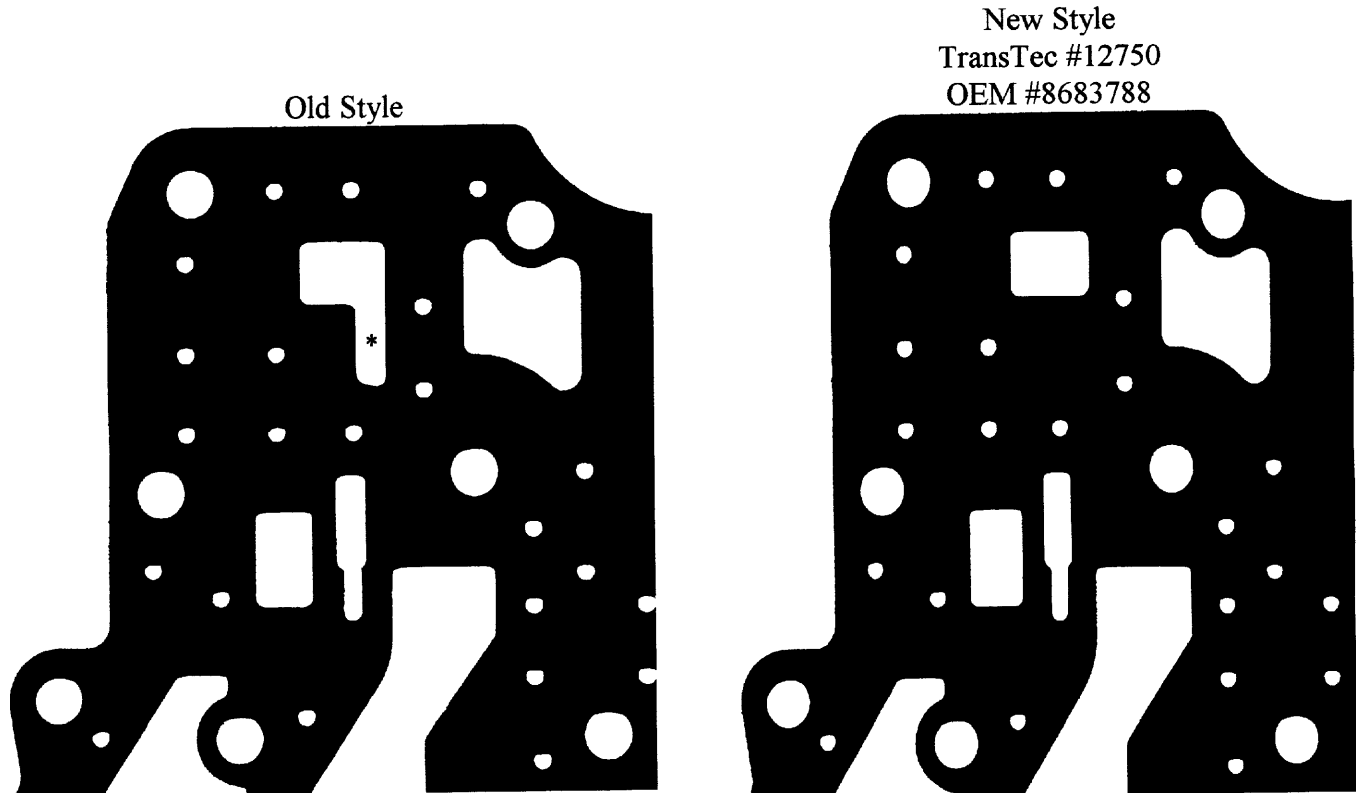


Illustration for reference only.

Visit our website at www.transtec.com

TB 14 12/2000